

Plat of Survey

N.W. Cor., Sec. 22, T17S-R3W
Found: BLM Brass Cap
Origin: BLM.

W. 1/4 Cor., N.W. 1/4, Sec. 22, T17S-R3W
Set: 1/2" x 24" rebar
Origin: W.B. Heller

N. 1/4 Cor. Sec. 22, T17S-R3W
Found: BLM "T" Bar, Origin: B.L.M.

N.E. Cor. Sec. 22, T17S-R3W
Found: 1/2" rebar
Origin: unknown

Section 22,
T17S - R3W

Note:
All positions are calculated
measured.

Center East, N.W. 1/4 Cor., Sec. 22, T17S-R3W
Set 1/2" x 24" rebar and I.D. cap
Origin: W.B. Heller

Date: December 15, 2007

Lindsborg Golf Club, Inc.
Parcel in the N. 1/2, Sec. 22,
T17S-R3W.

61.9 Acre incl. R/W
For: Lindsborg Golf Club, Inc.
C/o Dave Schrag
1541 Svensk Road
Lindsborg, KS 67456

Center Cor., Sec. 22, T17S-R3W
Set 1/2" x 24" rebar & I.D. cap
Origin: W.B. Heller

W. 1/4 Cor. Sec. 22, T17S-R3W
Found: 1/2" rebar
Origin: unknown

Heller Boundary Surveys, W.B. Heller, L.S. 1202, 863 S. 9th, Salina, KS 67401

Center Cor., Sec. 22, T17S-R3W
Set 1/2" x 24" rebar & I.D. cap
Origin: W.B. Heller

E. 1/4 Cor., Sec. 22, T17S-R3W
Found: 5/8" rebar
Origin: unknown

Ph: 1-620-245-8023

Pg. 4

Legend:

- ▲ = section corner found
- △ = section corner set
- = '1/2" x 24" rebar with I.D. cap
- P.O.B. = point of beginning
- ⊕ = section line
- ⊗ = property line
- R/W = Road right of way

E 1/4 Cor., Sec 22, T17S-R3W
Found: 5/8" rebar
Origin: unknown

Ph: 1-620-245-8023 Pg. 2/2

Heller Boundary Surveys

William B. Heller, L.S. 1202, 863 S. 9th Street, Salina, KS 67401
Ph: 785-819-3339, Cellular: 620-245-8023, Email: wheller@ks-usa.net


Certificate of Survey

This is to certify and acknowledge that I, William B. Heller, a registered land surveyor in the County of McPherson, State of Kansas, surveyed the following:

Legal Description : Commencing at the West One-sixteenth (1/16) Corner, Northwest Quarter (1/4) of Section Twenty-two (22), Township Seventeen (17) South – Range Three (3) West of the Sixth Principal Meridian, the point of beginning; thence North 90 degrees 00 minutes 00 seconds East on the North Section Line of said Section 22, 862.32 feet; thence South 00 degrees 07 minutes 57 seconds East, 216.00 feet ; thence North 90 degrees 00 minutes 00 seconds West, 201.00 feet; thence South 00 degrees 07 minutes 57 seconds East, 1,107.69 feet; thence South 89 degrees 52 minutes 52 seconds East, 657.77 feet; thence South 89 degrees 12 minutes 11 seconds East, 66.0 feet; thence South 00 degrees 01 minutes 14 seconds West, 662.52 feet; thence North 89 degrees 12 minutes 11 seconds West, 66.00 feet ; thence South 00 degrees 01 minutes 14 seconds West, 662.52 feet; thence North 89 degrees 45 minutes 37 seconds West, 1,308.46 feet; thence North 00 degrees 17 minutes 11 seconds West, 2,644.66 feet to the point of beginning. Said parcel contains 61.9 acres including existing road right of way. Said parcel is subject to any easements or restrictions of record.

William B. Heller, L.S. 1202
December 15, 2007

For: Lindsborg Golf Club, Inc.
c/o Dave Schrag
1541 Svensk Road
Lindsborg, KS 67456

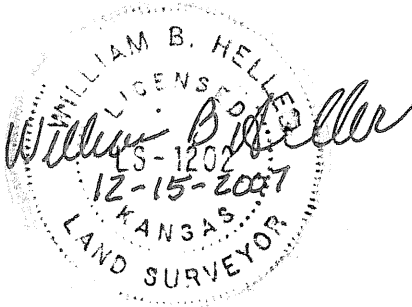

Report of survey

Research of the records at the McPherson County Public Works office revealed the following information:

Roads: Svensk Road right of way is 66.0' wide, 33.0' on each side of section line. Parcel contains 0.7 acre of road right of way.

Surveys: References found at the McPherson County Public Works Office. Survey for Virginia Patrick dated April 28, 2006 by W.B. Heller.

Field procedure: I set 1/2" x 24" rebar and I.D. caps at the property pins and section corners I monumented.